Selecting the Correct Cutting Values

1. fz depends on the Ap1 and ae values

With round inserts, two factors can affect the hm: Ap1 and ae.
fz has to be adjusted accordingly.

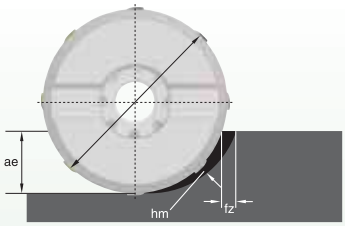

Recommended Starting Feed Rate Values (fz) Related to the Ap1 and ae Values:

ae engagement	10%	20%	30%	40%	50%	100%
Ap1 = 0,5mm	0,59mm	0,42mm	0,34mm	0,30mm	0,26mm	0,19mm
Ap1 = 0,75mm	0,50mm	0,36mm	0,29mm	0,25mm	0,22mm	0,16mm
Ap1 = 1mm	0,42mm	0,30mm	0,24mm	0,21mm	0,19mm	0,13mm
Ap1 = 1,5mm	0,34mm	0,24mm	0,20mm	0,17mm	0,15mm	0,11mm
Ap1 = 3,5mm	0,22mm	0,16mm	0,13mm	0,11mm	0,10mm	0,08mm

Example application highlighted.

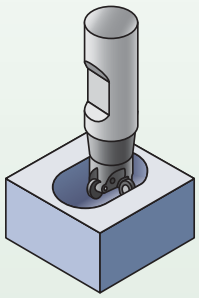

Example Cutting Conditions for RD..07... Insert in Pocketing, L/D ratio = 2 x D:

insert = RDPX0702M0SNMH		TN2505			TN6525			TN6540		
		feed per tooth fz (mm)/ae>50%								
		min	med	max	min	med	max	min	med	max
ae>50%	Recommended starting Ap1 = 0,5mm	0,19mm	0,22mm	0,30mm	0,19mm	0,30mm	0,35mm	0,19mm	0,30mm	0,40mm

2. Ap1 and vc corrections depend on L/D ratio

With increasing L/D ratios, or overhang, vibrations can occur due to reduced rigidity. To ensure successful application, it is recommended to adjust Ap1 and vc values according to the following table:

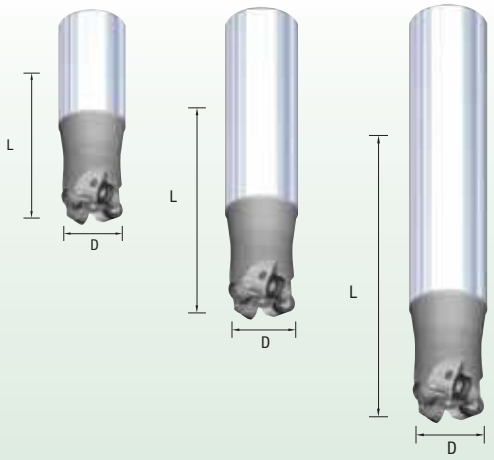

L/D ratio	% of Ap1 max to reduce	% of vc to reduce
<2	0%	0%
2<L/D<4	65–75%	10–15%
>4	80–95%	20–40%

Recommended Cutting Conditions • Helical Interpolation from Solid

cutter diameter	min hole diameter	max hole diameter (flat bottom)	Ap1 max per revolution	max ramp angle	Ap1 max when plunging
12	17mm	17mm	3,5mm	22°	1mm
15	18mm	23mm	2,8mm	18°	2,2mm
16	20mm	25mm	1,9mm	9°	1,4mm
20	28mm	33mm	3,5mm	12°	1,5mm
25	36,5mm	43mm	3,5mm	8.5°	2,5mm
30	46,4mm	53mm	3,5mm	6.5°	2,5mm