


■ Insert Selection Guide

Material Group	Light Machining		General Purpose		Heavy Machining	
	Geometry	Grade	Geometry	Grade	Geometry	Grade
P1-P2	ML	WP25PM	MM	WP40PM	MM	WP40PM
P3-P4	ML	WP25PM	MM	WP25PM	MH	WP40PM
P5-P6	ML	WP35CM	MM	WP35CM	MH	WP35CM
M1-M2	ML	WP25PM	ML	WU35PM	MM	WU35PM
M3	ML	WP25PM	MM	WU35PM	MM	WU35PM
K1-K2	MH	WK15CM	MH	WK15CM	MH	WP20CM
K3	MH	WK15CM	MH	WK15CM	MH	WP25PM
N1-N2	-	-	-	-	-	-
N3	-	-	-	-	-	-
S1-S2	ML	WS30PM	MM	WS30PM	MM	WU35PM
S3	ML	WS30PM	MM	WU35PM	MM	WU35PM
S4	ML	WS30PM	MM	WU35PM	MM	WU35PM
H1	MH	WP25PM	MH	WP20CM	-	-

iC10 • Inserts • RN.J10...

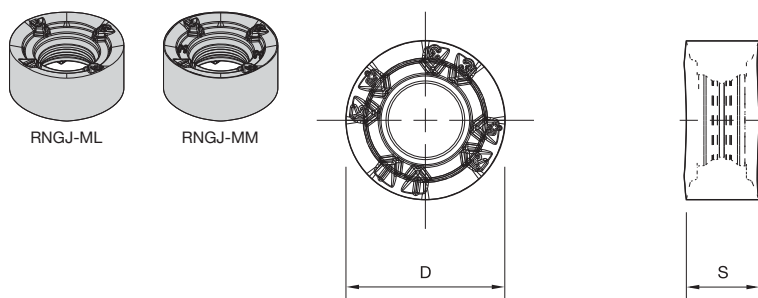

- ML geometry is the first choice for stainless steel and high-temp alloys.
- MM geometry is for general purpose, especially for steel.

● first choice  
○ alternate choice

P	●	●	●	●	●	●	●
M	○	○	○	○	○	○	○
K	○	○	○	○	○	○	○
N	○	○	○	○	○	○	○
S	○	○	○	○	○	○	○
H	○	○	○	○	○	○	○

■ RINGJ-ML

catalogue number	number of indexes	D	S	WK15CM	WP20CM	WP25PM	WS30PM	WU35PM	WP35CM	WP40PM
RNGJ10T3M0EML	8	10,00	4,76	○	○	●	●	●	○	○

■ RINGJ-MM

catalogue number	number of indexes	D	S	WK15CM	WP20CM	WP25PM	WS30PM	WU35PM	WP35CM	WP40PM
RNGJ10T3M0SMM	8	10,00	4,76	○	○	○	○	○	○	○